

Date

CUTTER AVIATION SAN ANTONIO, INC. - 367 SANDAU RD. - SAN ANTONIO, TEXAS 78216
PHONE (210) 384-3386 - FAX (210) 384-3394

MODEL: SOCATA TB21
DATE: 6-11-2004
HR. MTR: 401.59
W/O NO.: S2914
TIME SINCE NEW: 401.59

REG. NO.: N97GT
S/N: 2135
ACTT: 401.59
PROP S/N: DY5102B

- 1) COMPLIED WITH AN ANNUAL INSPECTION IN ACCORDANCE WITH THE SOCATA TB21 INSPECTION GUIDE FROM CHAPTER 5 OF THE TB21 MAINTENANCE MANUAL. RESEARCHED A. D.'S TO BIWEEKLY 2004-10.
- 2) REMOVED PROP AND SENT TO JORDAN PROPELLER SERVICE FOR REPLACEMENT OF THE ALCOHOL DEICE BOOTS. REINSTALLED PROP USING A NEW O-RING.
- 3) DRESSED PROP BLADES TO REMOVED NICKS.

I CERTIFY THIS **PROP** HAS BEEN INSPECTED IN ACCORDANCE WITH THE INSTRUCTIONS AND PROCEDURES OF A 100 HOUR/ANNUAL INSPECTION, FAR 43, APPENDIX D, AND IS CONSIDERED TO BE IN AIRWORTHY CONDITION AND APPROVED FOR RETURN TO SERVICE.

CUTTER AVIATION SAN ANTONIO, INC.
CRS U7TR491Y


DANA C. O'BANION

JORDAN PROPELLER SERVICE INC.

103 EAST RHAPSODY SAN ANTONIO, TEXAS 78216
Certificated Repair Station No. EK2R797K

PROPELLER S/N DY5102B HAS BEEN REPAIRED

~~AND/OR OVERHAULED~~ I/AW MANUALS 113B, 133C & 202A.

REPLACED ANTI-ICE FEED SHOES, REFINISHED
BLADE TIPS AND STATICALLY BALANCED.

PERTINENT DETAILS ON FILE UNDER W.O. 9881

SIGNED Bary C. Jordan DATE 6-02-04

MECHANIC MAKING INSTALLATION ON A/C MUST C/W FAR 43.9

WARNER PROPELLER & GOVERNOR CO.

5102 S. Country Club Rd., Tucson, Az. 85706 FAA CRS # W59R659N

WORK ORDER

10103

CUSTOMER INFORMATION

BILLING		SHIPPING	
Name	Richard Pomroy	Name	Richard Pomroy
Address	P.O. Box 1365	Address	P.O. Box 1365
City/State/Zip	Hereford, AZ 85615	City/State/Zip	Hereford, AZ 85615
Contact person	Richard	Phone	520-266-1836
Date Recieved	9/10/13	Date promised	N/A

AIRCRAFT INFORMATION

A/C model	TB-21	Engine M/N	TIO-540
A/C Serial	2135	N#	97GT
		Engine S/N	N/A

COMPONENT INFORMATION

Item	Propeller	Manufacturer	Hartzell	Model #	HC-C3YR-1RF		
Serial #	DY5102B	Part #	C3R00045	TTSN	Not reported	TTSO	N/A
Reason for repair	Calender timed out						
Work to be performed	Overhaul						
The customer authorizes the above repairs to be made to the above components							
Customer signature _____							
REQUIRED DOCUMENTS							
<input type="checkbox"/> New logbook <input checked="" type="checkbox"/> Maintenance release <input type="checkbox"/> CofA <input type="checkbox"/> 337 <input type="checkbox"/> Origin <input type="checkbox"/> Other _____							

MAINTENANCE INFORMATION

Inspection results	Blade knobs require shot peen, pitch blocks require chamfer, piston rod requires secondary cotter pin hole					
Additional work required	Shot peen blade knobs and perform machining operations during overhaul					
Parts installed	1ea HC-C3YR-1RF-OH, 3ea 37572					
Work performed	Overhaul and static balance					
S/B, S/L, A/D compliances	S/B 118FR1, 136R1 S/L 61YR3, 217, 229R2, 267, 282R1, 293R1					
Maintenance release issued	8130-3	Number	33530	Date issued	10/7/13	
Attachments to this work order	MM20,list,jpac,8130-3,MM27,MM20-1(3pgs)					

OCT 07, 2013 TTSN Not Reported TSO 0.0
Overhaul and static balance. Refer to
WO# 10103 and 8130-3 # 33530 for details.



Brooke Warner
Warner Propeller Tucson, AZ
FAA CRS# W59R659N

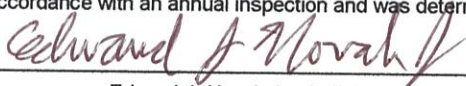


5/12/2015 N97GT Socata TB21, serial # 2135 Propeller Logbook

Tach Hours: 799.54 :: Aircraft TT: 799.54 :: #1 Engine TT: 799.54 :: Prop. TT: 799.54 :: Prop. TSMOH: 35.54

Completed annual inspection in accordance FAR 43, appendix D using the TB21 Maint. Manual Insp. Form as a guide.

I certify that this Propeller has been inspected in accordance with an annual inspection and was determined to be in an airworthy condition.

Signed 
Edward J. Novak Jr. A+P 2832024 IA

N97GT Tach 885.27 10-02-2018

- replaced TKS travel tube B-4689
- inspected propeller as Annual inspection

Propeller Total Time 885.27
TSMPOH 121.24


Walter Hankinson
A&P 3322555 I.A.
Big Sky Aviation, Millville NJ

